Subject:	Installing a Backup Alarm Silverado EV WT
Models Years Affected:	2024 – Beyond
Models Affected:	Silverado EV WT
Origination Date:	May 20, 2024
Revision Date:	N/A

ADVISORY:

Condition/Concern:

Upfitters looking to install an after-market backup alarm on the vehicle need wiring and mounting information.

Recommendations:

It is recommended that upfitters utilize the Trailer Backup lamp circuit (circuit 1624/yellow wire) to install their after-market backup alarm.

CAUTION: Prior to mounting the backup refer to UI Bulletin 195 for information on the NO DRILL areas to prevent any damage to the vehicle's HV components and/or personal injury.

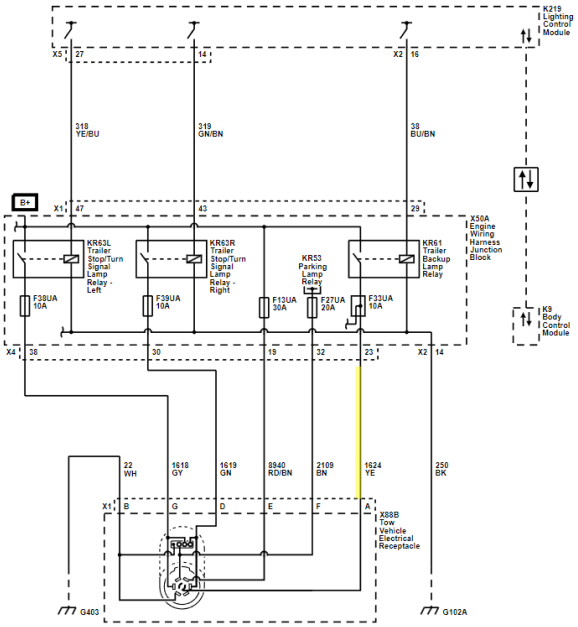

Disclaimer: GM Upfitter Integration Technical Bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service and/or modification of a vehicle. These properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. Contact GM Upfitter Integration for information on whether the information is applicable your vehicle.

1. The trailer wiring is accessible by removing the close-out panel behind the LR wheel – (see figure 1).
2. Partially remove the harness tape wrapping to expose the wires in the harness – (see figure 2)
3. Insert a Loop back circuit to the backup alarm as shown in Figures 3 and 4 or simply tap into the yellow wire. Be sure to use environmentally seal connections to prevent any corrosion to the wiring.

General placement: Under back-driver's side of truck bed

Figure 1

Reverse Signal View: Back driver's side of vehicle. Yellow wire (once visible)

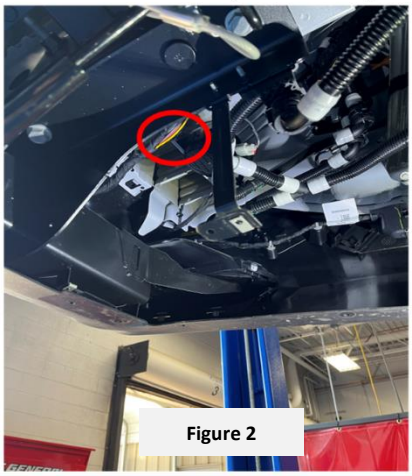

Figure 2

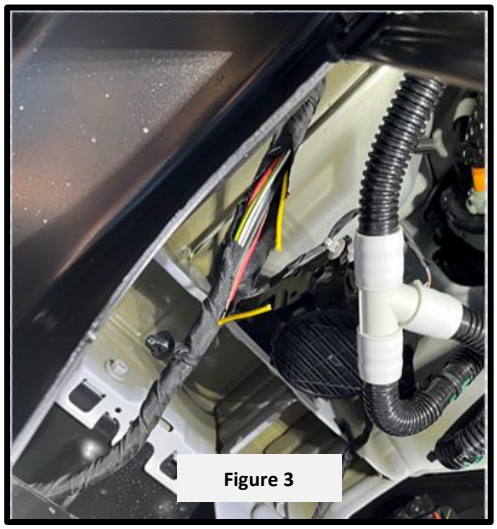

Figure 3

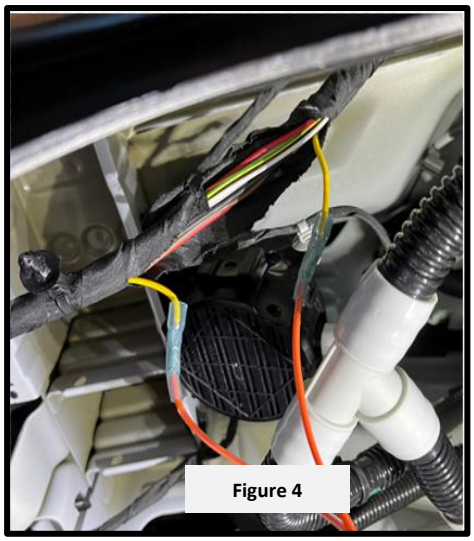

Figure 4

Additional Information:

Use of the trailer backup lamps circuit prevents the unwanted activation of the backup alarm during entry and exit lighting events.

Disclaimer: GM Upfitter Integration Technical Bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service and/or modification of a vehicle. These properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. Contact GM Upfitter Integration for information on whether the information is applicable your vehicle.